



#145

Historic Architectural Inventory for
Division of Parks and Historic Preservation Department of Natural Resources

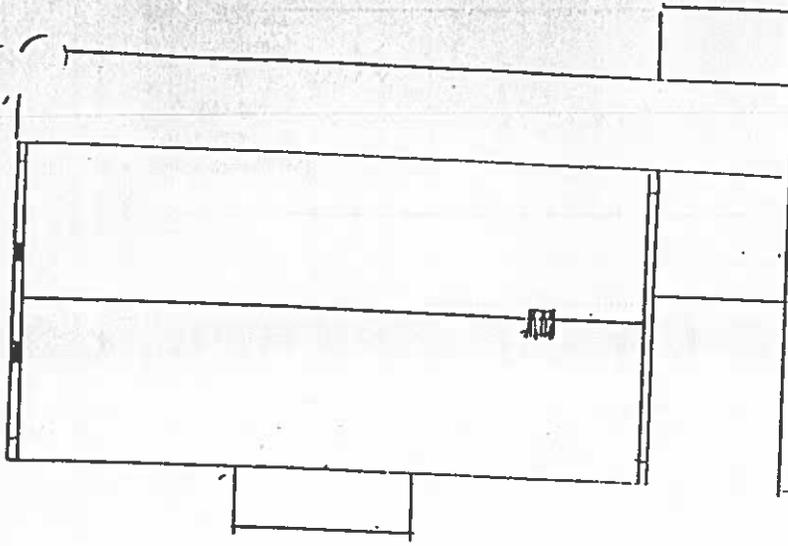

Inventory Number: 145
Date: 1/15/80
Location: ...
Description: ...
Architect: ...
Style: ...
Material: ...
Condition: ...
Notes: ...

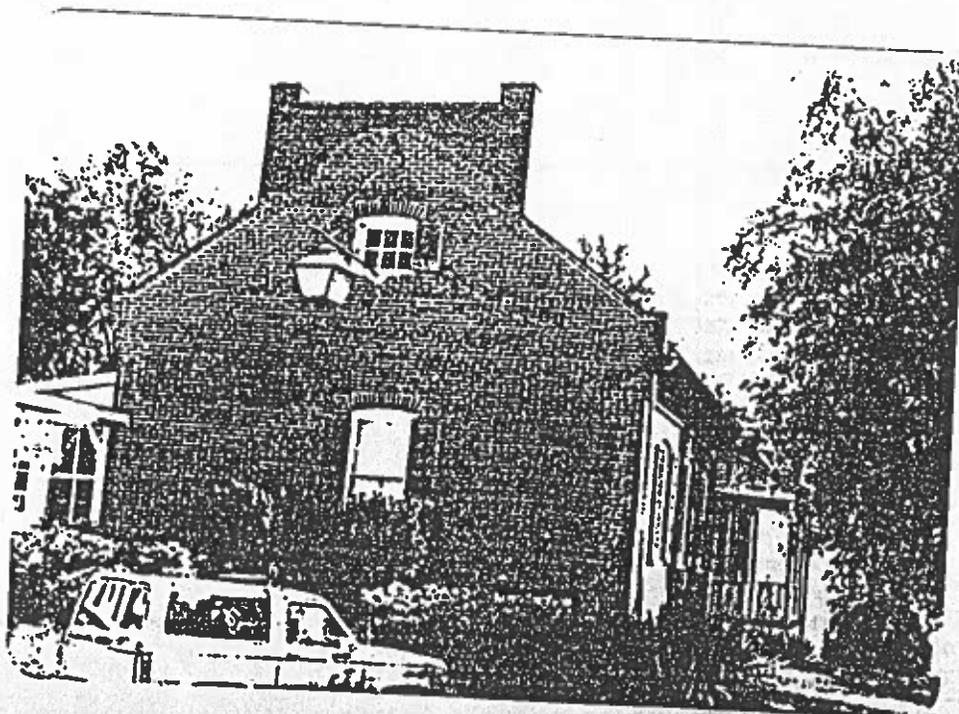

City Code: 220
220
7/26/80

45

Missouri Heritage Trust
David Denman
9-20-84

inventory number: 45

Address: 105 2nd street

General description: One and one half story rectangle shaped building constructed of brick laid in common bond resting on a rubble stone foundation with a full cellar beneath.

Setting: The building is set back approx. ten feet from the sidewalk. There is about the same distance between the building to the east though a modern addition fills part of the space. The backyard extends back to the alley.

Roof: Endgable roof covered with corrugated metal.

Cornice: Unusual corbeled cornice with the upper three courses angled to create the impression of a concave surface above a stretcher course and header dentil which inturn projects above a stretcher course. Four courses below is a projecting stretcher band.

Facade: Seven symmetrical bays on the facade with the fourth and fifth bays as entrys. There is a shed roof porch over the entrys which appears to be modern though reusing old materials.

Windows: Segmental arch with alternating stretcher course and double header course. Wood sills, round mould surrounds, two over two light sash with flat head upper sash and with shutters at the facade window openings. The attic windows have fixed six light sash. The single west elevation window has a beaded surround.

Doors: The fifth bay entry has a round mould surround and a two light transom above an inverted cross door with glass filled upper panels. The fourth bay entry has a applied mould surround with a one light transom.

Side elevations: East: Parapet gable wall with stretcher brick coping and with eave steps. There is a centered attic window and a single visible window at the first story. A modern frame addition obscures the rest. West: The parapet with peak step appears to be severely altered, though perhaps rebuilt along original lines--it is difficult to tell without more examination. There is one centered attic window and a single first story window opening.

Rear elevation: There is a modern framed in porch with recent concrete foundation with shed roof. There appears to be some old details reused in the newer structure.