

### V-008 ZINC CHROMATE RED OXIDE HI SOLIDS PRIMER

**PRODUCT DESCRIPTION:** V-008 Zinc Chromate Red Oxide Primer is formulated with a special chemical and corrosion resistant pigments, combined with a special resin for excellent adhesion. Excellent for fast handling of steel, where a lead free primer is needed.

**INTENDED USES:** Shop coating or field priming weather-exposed structural and miscellaneous steel tanks, machinery, and equipment to be top coated with most oil, alkyd, or latex topcoats. Do not use on galvanized metal or immersion service. For optimum performance a topcoat is required for exterior exposures.

**SURFACE PREPARATIONS:** For best results, it is important that all surface contaminants, such as moisture, oil, dirt, rust, and mill scale be removed before application of this primer. V-008 zinc chromate red oxide primer can be applied to either blasted, hand, or power tool cleaned steel. A minimum of SSPC-2 hand tool cleaning required.

# PHYSICAL INFORMATION

COLOR: RED OXIDE GLOSS LEVEL: FLAT SOLIDS BY WEIGHT: 70%

**RECOMMENDED DRY FILM THICKNESS:** 1.5-2.0 MILS **THEORETICAL COVERAGE:** 350-400 SQ FT PER GALLON

METHOD OF APPLICATION: AIRLESS SPRAY, AIR SPRAY, BRUSH, AND ROLLER

# DRYING TIME @ 72 F


TO TOUCH: 30 MINUTES TO HANDLE: 60-90 MINUTES TO RECOAT: 60-90 MINUTES

### REGULATORY DATA

**FLASHPOINT: 46 F** 

PRODUCT WEIGHT: 11.75 LB

MATERIAL VOC: 2.49 POUNDS PER GALLON / 298 GRAMS PER LITER COATING VOC: 2.72 POUNDS PER GALLON / 325 GRAMS PER LITER

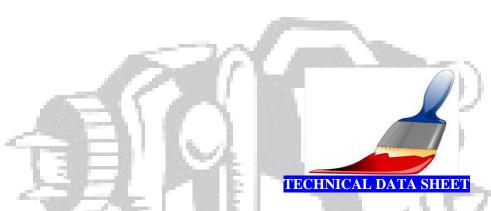

# APPLICATION

**MIXING:** This material is a one-component coating and should always be mixed thoroughly with a power agitator before application.

MIX RATIO: Not applicable

WORKING POT LIFE: Not applicable

**AIRLESS SPRAY:** Recommended Tip range 15-17 thou (0.38-0.43 mm)

Total output fluid pressure at spray tip not less

than 2,500 p.s.i.

AIR SPRAY: Recommended Gun DeVilbiss MBC or JGA

(Pressure Pot) Air Cap 704

Tip E

**BRUSH:** Suitable Typically 1.5-2.0 mils can be achieved. Care

should be taken to avoid under application.

**ROLLER:** Suitable Typically 1.5-2.0 mils can be achieved. Care

should be taken to avoid under application.

**THINNER:** Xylene Do not thin more than allowed by local

environmental legislation.

**CLEANER:** Xylene

WORK STOPPAGES: Thoroughly flush all equipment with xylene. All unused material should be stored in tightly closed containers. Partially filled containers may show surface skinning and / or viscosity increase of the material after storage. Material should be filtered prior to use.

**CLEAN UP:** Clean all equipment immediately with xylene. It is good working practice to periodically flush out spray equipment during the course of the working day. Frequency of cleaning will depend upon amount sprayed, temperature and elapsed time, including any delays.

All surplus materials and empty containers should be disposed of in accordance with appropriate regional regulations / legislation.

#### SYSTEM COMPATIBILITY

The following topcoats are recommended for V-008 red oxide zinc chromate primer.

Alkyds

Silicone Alkyds

Latex

#### SHIPPING & STORAGE

**NUMBER OF COMPONENTS: 1** 

**PACKAGED IN:** 55-Gallon Drums, 5 Gallon Pails, and 1 Gallon Cans **STORAGE TEMPERATURE:** Minimum 20 F. Maximum 110 F.

